



325-829-0146

www.rennerinspectionsservices.com

david@rennerinspectionsservices.com



INSPECTED FOR

**Derrick & Akiko Beale
3417 Chimney Rock Rd
Abilene, TX 79606**

October 18, 2018

PROPERTY INSPECTION REPORT

Prepared For: Derrick & Akiko Beale
(Name of Client)

Concerning: 3417 Chimney Rock Rd, Abilene, TX 79606
(Address or Other Identification of Inspected Property)

By: Felipe Cruz, Lic #22478 / NAWT #13743ITC 10/18/2018
(Name and License Number of Inspector) (Date)

PURPOSE, LIMITATIONS AND INSPECTOR / CLIENT RESPONSIBILITIES

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules (“Rules”) of the Texas Real Estate Commission (“TREC”), which can be found at www.trec.texas.gov.

The TREC Standards of Practice (Sections 535.227-535.233 of the Rules) are the minimum standards for inspections by TREC-licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is NOT required to turn on decommissioned equipment, systems, utility services or apply an open flame or light a pilot to operate any appliance. The inspector is NOT required to climb over obstacles, move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer’s installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector shall indicate, by checking the appropriate boxes on the form, whether each item was inspected, not inspected, not present or deficient and explain the findings in the corresponding section in the body of the report form. The inspector must check the Deficient (D) box if a condition exists that adversely and materially affects the performance of a system or component or constitutes a hazard to life, limb or property as specified by the TREC Standards of Practice. General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing components, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported may be considered life-safety upgrades to the property. For more information, refer to Texas Real Estate Consumer Notice Concerning Recognized Hazards or Deficiencies below.

THIS PROPERTY INSPECTION IS NOT A TECHNICALLY EXHAUSTIVE INSPECTION OF THE STRUCTURE, SYSTEMS OR COMPONENTS. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller’s disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector’s responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

ITEMS IDENTIFIED IN THE REPORT DO NOT OBLIGATE ANY PARTY TO MAKE REPAIRS OR TAKE OTHER ACTIONS, NOR IS THE PURCHASER REQUIRED TO REQUEST THAT THE SELLER TAKE ANY ACTION. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

TEXAS REAL ESTATE CONSUMER NOTICE CONCERNING HAZARDS OR DEFICIENCIES

Each year, Texans sustain property damage and are injured by accidents in the home. While some accidents may not be avoidable, many other accidents, injuries, and deaths may be avoided through the identification and repair of certain hazardous conditions. Examples of such hazards include:

- malfunctioning, improperly installed or missing ground fault circuit protection (GFCI) devices for electrical receptacles in garages, bathroom, kitchens, and exterior areas;
- malfunctioning arc fault protection (AFCI) devices;
- ordinary glass in locations where modern construction techniques call for safety glass;
- malfunctioning or lack of fire safety features such as, smoke alarms, fire-rated doors in certain locations, and functional emergency escape and rescue openings in bedrooms;
- malfunctioning carbon monoxide alarms;
- excessive spacing between balusters on stairways and porches;
- improperly installed appliances;
- improperly installed or defective safety devices;
- lack of electrical bonding and grounding; and
- lack of bonding on gas piping, including corrugated stainless steel tubing (CSST).

To ensure that consumers are informed of hazards such as these, the Texas Real Estate Commission (TREC) has adopted Standards of Practice requiring licensed inspectors to report these conditions as "Deficient" when performing an inspection for a buyer or seller, if they can be reasonably determined.

These conditions may not have violated building codes or common practices at the time of the construction of the home, or they may have been "grandfathered" because they were present prior to the adoption of codes prohibiting such conditions. While the TREC Standards of Practice do not require inspectors to perform a code compliance inspection, TREC considers the potential for injury or property loss from the hazards addressed in the Standards of Practice to be significant enough to warrant this notice.

Contract forms developed by TREC for use by its real estate licensees also inform the buyer of the right to have the home inspected and can provide an option clause permitting the buyer to terminate the contract within a specified time. Neither the Standards of Practice nor the TREC contract forms requires a seller to remedy conditions revealed by an inspection. The decision to correct a hazard or any deficiency identified in an inspection report is left to the parties to the contract for the sale or purchase of the home.

INFORMATION INCLUDED UNDER "ADDITIONAL INFORMATION PROVIDED BY INSPECTOR", OR PROVIDED AS AN ATTACHMENT WITH THE STANDARD FORM, IS NOT REQUIRED BY THE COMMISSION AND MAY CONTAIN CONTRACTUAL TERMS BETWEEN THE INSPECTOR AND YOU, AS THE CLIENT. THE COMMISSION DOES NOT REGULATE CONTRACTUAL TERMS BETWEEN PARTIES. IF YOU DO NOT UNDERSTAND THE EFFECT OF ANY CONTRACTUAL TERM CONTAINED IN THIS SECTION OR ANY ATTACHMENTS, CONSULT AN ATTORNEY.

ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

Inspection Time In: **8:30 am** Time Out: **11:30 am** Property was: **Vacant**

Building Orientation (For Purpose Of This Report Front Faces): **North**

Weather Conditions During Inspection: **Cloudy Overcast & Raining**

Outside temperature during inspection: **40 to 50 Degrees**

Parties present at inspection: **No other parties present during inspection.**

This report contains technical information. If you were not present during this inspection, please call the office to arrange for a consultation with your inspector. If you choose not to consult with the inspector, this inspection company cannot be held liable for your understanding or misunderstanding of the reports content.

The digital pictures in this report are a sample of the damages in place and should not be considered to show all of the damages and/or deficiencies found. There will be some damage and/or deficiencies not represented with digital imaging.

THIS REPORT IS PAID AND PREPARED FOR THE EXCLUSIVE USE BY Derrick & Akiko Beale. THIS COPYRIGHTED REPORT IS NOT VALID WITHOUT THE SIGNED INSPECTION AGREEMENT.

THIS REPORT IS NOT TRANSFERABLE FROM THE CLIENT NAMED ABOVE

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

I. STRUCTURAL SYSTEMS

A. Foundations

Type of Foundation(s): Slab on Ground

Comments:

Foundation Is Performing Adequately

In my opinion, the foundation appears to be providing adequate support for the structure at the time of this inspection. I did not observe any apparent evidence that would indicate the presence of adverse performance or significant deficiencies in the foundation. The interior and exterior stress indicators showed little affects of adverse performance and I perceived the foundation to contain no significant unlevelness after walking the 1st level floors.

Additional Observations and/or Comments:

- One or more of the foundation perimeter beam corners were observed to be sheared off (corner pop). This is a common condition in slab on grade foundations. This condition does not adversely affect the performance of the foundation. However, in some cases, some cosmetic improvements may be necessary.
- **Note:** Tree(s) in close proximity of the foundation was observed. Client should consider the installation of a root barrier to reduce the possibility of damage to the foundation from tree roots and moisture removal.

Foundation Maintenance & Care

- **Note:** Proper drainage and moisture control is needed with all foundation types. Due to the expansive nature of the load bearing soils in the area it is important to direct water away from the foundation at all locations and that the soil moisture content be maintained at a constant level around the structure. Improper drainage and moisture control may contribute to greater than normal foundation movement.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



B. Grading and Drainage

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

Gutter & Downspout System

- **Note:** The gutter downspouts should discharge water at least thirty-six inches (36") away from the foundation perimeter beam. Storm water should be encouraged to flow away from the structure at the points of discharge.
- The gutters require cleaning.



C. Roof Covering Materials

Type(s) of Roof Covering: Composition

Viewed From: Inspected from drip edge with ladder

Comments:

Roof Covering

- The composition roofing material has experienced considerable granular lose in various locations throughout the roof.

Flashing Details

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



D. Roof Structures and Attics

Viewed From: From Interior of Attic

Approximate Average Depth of Insulation: 13+”

Approximate Average Thickness of Vertical Insulation: 2” - 4”

(Note: Recommended depth of attic floor insulation is approx. 10+ inches to achieve a R30 rating.)

Insulation Type: Loose Filled, Batt or Blanket

Description of Roof Structure: Rafter Assembly

Attic Accessibility: Partial

Comments:

Roof Structure

All components were found to be performing and in satisfactory condition on the day of the inspection.

Attic Ventilation

All components were found to be performing and in satisfactory condition on the day of the inspection.

Attic Insulation

- The attic insulation was observed to be in contact with the chimney flue pipe. The insulation should be moved away and/or an insulation shield installed to reduce the risk of fire.

Attic Ladder(s)

All components were found to be performing and in satisfactory condition on the day of the inspection.


I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

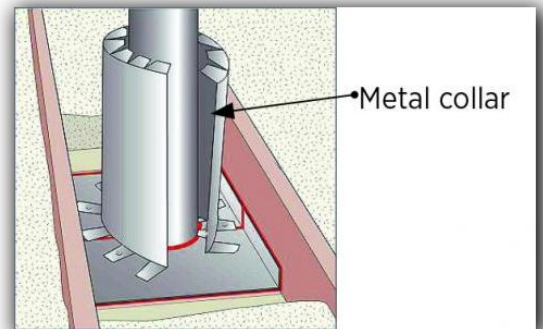

E. Walls (Interior and Exterior)

Description of Exterior Cladding: Wood Type Veneer, Brick Veneer

Comments:

Interior Walls & Surfaces

- **Note:** There is evidence of painting and patching to the interior finish and prior interior finish repairs. This condition could limit the Inspectors visual observations and ability to render accurate opinions as to the performance of the structure.
- Interior wall stress cracks were observed in the various locations throughout the house.
- Recommend sealant material improvements for the area between the interior walls and window frames.

Exterior Walls & Surfaces

- Caulking improvements are recommended for the area between the exterior veneer and the exterior door frames, window frames and garage door trim boards.
- Mortar improvements are recommended for the exterior masonry veneer on the south side of the structure.
- Exterior wall trim was observed to be pulling away in the north side of the structure.
- Some of the exterior wood trim surfaces needs a fresh coat of paint.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



F. Ceilings and Floors

Comments:

Ceilings

- Ceiling stress cracks were observed in the dining room area, garage, front corner bedroom, front entrance area.
- Ceiling opening was observed in the front corner bedroom closet.

I=Inspected

NI=Not Inspected


NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

Floors

- The floor tile(s) were observed to be cracked and/or damaged in dining room area.

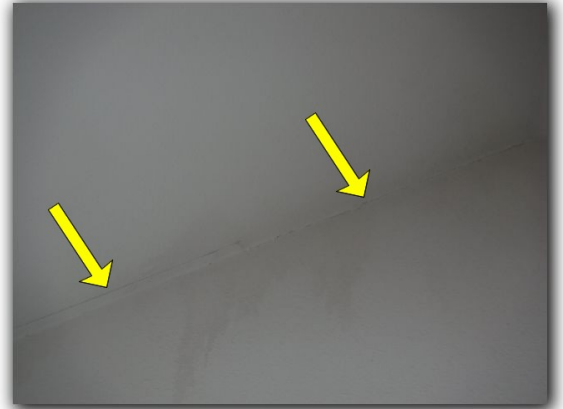

G. Doors (Interior and Exterior)

Comments:

Interior Doors

- The door hardware is missing to the pantry.

Exterior Doors

- Weather-stripping improvements are recommended for the exterior doors.
- The exterior door frame has some deterioration and/or damage to the backyard entry door(s).

Overhead Garage Door

- The overhead garage door was observed to be unlevel.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



H. Windows

Comments:

Window Screens

All components were found to be performing and in satisfactory condition on the day of the inspection.

Windows

- One or more of the thermal pane windows were observed to have lost their seals. This has resulted in condensation or a fog like film to develop between the panes of glass. The thermal pane windows no longer function as designed when they loose their seal and replacement may be necessary. The windows that have noticeably lost their seals are listed but may not be limited to the following: side middle bedroom, front corner bedroom.

Special Notice: Signs of lost seals in the thermal pane windows may appear and disappear as temperature and humidity changes. Some windows with lost seals may not be evident at the time of this inspection. Windows are checked in a non-exhaustive manner for obvious fogging. When lost thermal pane window seals were noted, we recommend all windows be rechecked by a window specialist for further evaluation.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



I. Stairways (Interior and Exterior)

Comments:

J. Fireplaces and Chimneys

Comments:

- **Note:** I was unable to light up the gas fireplace at the time of the inspection. The homeowner should be consulted about the conditions of the gas fireplace.
- **Note:** A bracket is being used to hold the gas fireplace bottom cover.



K. Porches, Balconies, Decks, and Carports

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

L. Other

Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

II. ELECTRICAL SYSTEMS

A. Service Entrance and Panels

Panel Box

Box Rating and/or Main Disconnect Rating: 200 amps

Box Location: East Exterior Wall

Cabinet Manufacturer: Square D

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.



B. Branch Circuits, Connected Devices, and Fixtures

Type of Wiring: Copper

Comments:

Receptacle Outlets

- All exterior receptacles should have weather tight (bubble) covers.
- **Note:** I was unable to open the receptacles cover plate on the floor in the living room area.

Switches

All components were found to be performing and in satisfactory condition on the day of the inspection.

- **Note:** I was unable to determine the operation end of one or more of the switches.

Fixtures

All components were found to be performing and in satisfactory condition on the day of the inspection.

Smoke Alarms

All components were found to be performing and in satisfactory condition on the day of the inspection.

- **Note:** It is recommended to test for proper operation monthly and replace the batteries in all of the smoke detectors once a year for reasons of safety.

Carbon Monoxide Alarms

- I was unable to locate a carbon monoxide alarm in the immediate vicinity of the bedrooms.

Doorbell / Chime

All components were found to be performing and in satisfactory condition on the day of the inspection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D



III. HEATING, VENTILATION AND AIR CONDITIONING SYSTEMS

A. Heating Equipment

Type of System: **Central Heating System**

Energy Source: Gas

Brand Name: RUUD

Comments:

This component appears to be performing adequately at the time of this inspection. It is achieving an operation, function, or configuration consistent with accepted industry practices for its age.

B. Cooling Equipment

Type of System: **Central Cooling System**

Today's Temperature Differential (Delta-T): **15 Degrees**

Approximate System Age: **2003**

Approximate System SEER: **Unable To Determine**

Approximate System Size: **3.5 ton**

Brand Name: RUUD

Comments:

This component appears to be performing adequately at the time of this inspection. It is achieving an operation, function, or configuration consistent with accepted industry practices for its age.

Additional Observations and/or Comments:

- The outside condenser/coil does not appear to have proper clearance above the finish grade (ground). The outside unit should have a minimum of 3-inches of clearance above finish grade (ground). This condition should be corrected to help prevent damage to the unit.

Notice: Temperature differential readings are a fundamental standard for testing the proper operation of the cooling system. The normal acceptable range is considered approximately **between 15 to 23 degrees F**. total difference between the return air and supply air. Unusual conditions such as excessive humidity, low outdoor temperatures, and restricted airflow may indicate abnormal operation even through the equipment is functioning basically as designed and occasionally may indicate normal operation in spite of an equipment malfunction.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



C. Duct Systems, Chases, and Vents

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

IV. PLUMBING SYSTEMS

A. Plumbing Supply, Distribution Systems and Fixtures

Location of water meter: Within 5-feet of Front Curb

Location of main water supply valve: Within 3-feet of north exterior wall.

Static water pressure reading: 50 to 60 psi

Comments:

Water Supply System

All components were found to be performing and in satisfactory condition on the day of the inspection.

Exterior Faucets/Fixtures

- One or more of the exterior water hose bibbs (faucet) do not have a back-flow or anti-siphon device (Vacuum Breakers) in place. **Note:** *This is not uncommon to observe with a home of this age and can easily be obtained at home improvement stores if desired.*
- The exterior water hose bibb (faucet) is leaking at the handle when operated on the south side of the structure.

Laundry Connections

All components were found to be performing and in satisfactory condition on the day of the inspection.

Kitchen Sink

All components were found to be performing and in satisfactory condition on the day of the inspection.

Hall Bathroom

Bathtub

- The shower spout is leaking at the neck connection.
- The bathtub shower head diverter is not functioning properly.

Master Bathroom

Shower

- The shower spout is leaking at the neck connection.

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



-
-
-
-

B. Drains, Wastes, and Vents

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

- **Note:** While water was run down the drains, this cannot simulate the waste flows characteristics of a fully occupied structure. Unless specified, fixtures and vessels were not filled to capacity for leak testing to prevent inadvertent water damage to the property. This means that some leaks may go undetected. Comprehensive water leak testing, including hydrostatic testing, may be available from qualified, licensed plumbers. You may also consider further testing and inspection of the sewer line(s) in older homes (40+ years), homes with previous foundation repair, and homes with evidence of poor foundation performance.
- **Note:** I was unable to locate the plumbing cleanout(s).

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

-

C. Water Heating Equipment

Energy Source: Gas

Capacity: 50 Gallons

Location: Garage

Approximate Age: 2017

Brand Name: Rheem

Comments:

This component appears to be performing adequately at the time of this inspection. It is achieving an operation, function, or configuration consistent with accepted industry practices for its age.

Additional Observations and/or Comments:

- The plastic tubing / piping being used for the temperature and pressure relief (TPR) valve discharge pipe is not listed nor labeled for this type of use.
- The temperature and pressure relief discharge pipe is terminating into the water heater drain pan. Under current building standards, this discharge pipe should run downward to the exterior of the structure, turn downward, and terminate within 6-inches of the ground.
- The water heater flue collar is loose.



-

D. Hydro-Massage Therapy Equipment

Comments:

-

E. Gas Distribution Systems

Comments:

All components were found to be performing and in satisfactory condition on the day of the inspection.

-

F. Other

Comments:

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

V. APPLIANCES

A. Dishwashers

Comments:

Brand Name: Frigidaire

This component appears to be performing adequately at the time of this inspection.

Additional Observations and/or Comments:

- The dishwasher soap dispenser component was observed to be damaged.



B. Food Waste Disposers

Comments:

Brand Name: Badger

This component appears to be performing adequately at the time of this inspection.

- **Note:** Rust was observed at the food waste disposal.



I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I NI NP D

C. Range Hood and Exhaust Systems

Comments:

Brand Name: Hotpoint

This component appears to be performing adequately at the time of this inspection.


D. Ranges, Cooktops, and Ovens

Comments:

Range Brand Name: Whirlpool

The oven was set to 350 degrees. When tested, at least 30 minutes later, the temperature rose to 360 degrees and held that temperature. A +/- of 25 degrees is considered acceptable.

- The range can be easily tipped over and should be equipped with an anti-tip device, for safety.

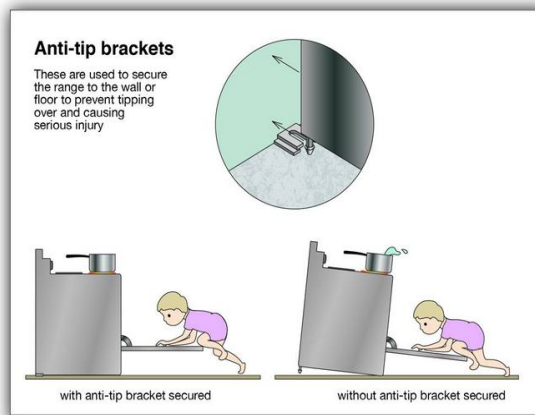


E. Microwave Ovens

Comments:

Brand Name: Hotpoint

- The microwave oven exterior handle was observed to be damaged.
- The microwave oven turn table does not appear to be functioning properly.

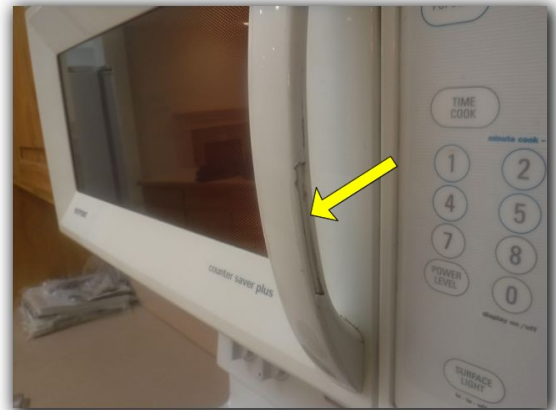

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

-
-
-
-

F. Mechanical Exhaust Vents and Bathroom Heaters

Comments:

Exhaust Vent

- One or more of the light bulbs were observed to be inoperative in the hall bathroom.
- **Note:** The bathroom exhaust vents were observed to be venting into the attic area and not to the exterior of the structure. This is an “as-built” condition per local building codes but we are required to mark it as deficient per the TREC standards of practice.
- **Note:** Recommend cleaning the mechanical exhaust vent to improve the air flow.

Bathroom Heaters

- The bathroom heater is inoperative in the hall bathroom.




-
-
-
-

G. Garage Door Operators

Comments:

- The opener arm is loose at the door connection and needs to be re-secured.
- The garage door reverse sensors are not properly installed. The garage door reverse sensors should be installed within 6-inches of the garage floor.

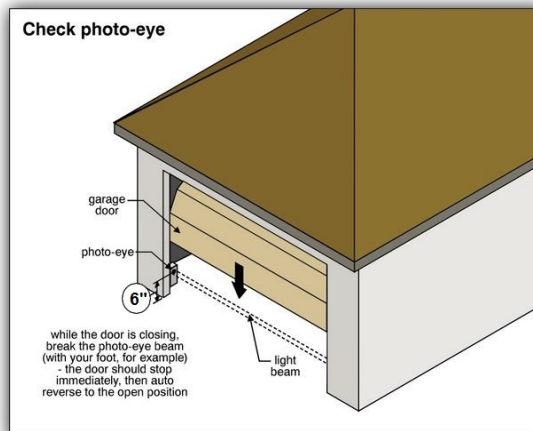

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---

-

H. Dryer Exhaust Systems

Comments:

- The dryer exhaust duct (vent pipe) is dirty and needs to be cleaned.
- The dryer duct termination is not properly sealed on the attic side of the roof structure penetration and is allowing dryer lint to fall back into the attic area.



-

I. Other

Comments:

VI. OPTIONAL SYSTEMS

-

A. Landscape Irrigation (Sprinkler) Systems

Comments:

Note: When the system is operational, all of the sprinkler system associated components are inspected and operated in the manual settings only.

Approximate Total Number of Wired Zones: 3

Sprinkler System and Associated Components

The sprinkler system and associated components should be further evaluated and/or serviced by a Licensed Irrigation Technician. The observations made to support the rendering of this opinion are listed but not limited to the following:

- I was unable to locate a moisture (rain / freeze) sensor device for the sprinkler system. This is an “*as-built*” condition, but Per TREC standards of practice we are required to report this condition as a deficiency.
- One or more of the sprinkler heads need to be adjusted so not to spray water onto the exterior walls, surfaces or windows in stations; **2.**
- One or more of the sprinkler heads do not pop-up high enough to disperse water properly in station(s); **1.**
- One or more of the sprinkler heads do not disperse water properly in stations(s); **1.**
- One or more of the sprinkler heads were observed to be damaged and/or missing in station(s); **1, 3.**
- The drip irrigation line below the grass appears to be damaged in station(s); **1.**

I=Inspected

NI=Not Inspected

NP=Not Present

D=Deficient

I	NI	NP	D
---	----	----	---



REPORT SUMMARY

This "Report Summary" is provided to assist clients and their representative(s) in viewing items listed in the Inspection Report as "Deficient". It *IS NOT* a list of mandatory or required repairs. It is the client(s) responsibility to determine what, if any, item(s) are repaired and to prepare any repair request. The Report Summary is intended to follow the flow of the main body of the Inspection Report and IS NOT a suggested or priority repair list. The order of repair priority is left up to the sole discretion of the client and we will not be able to assist you specifying the order of importance. Further, this summary contains only those items identified as "Deficient". There may be other items listed in the full body of the Inspection Report that could be important to you and you may consider adding to your repair request if and when applicable.

You should read and understand the entire Property Inspection Report prior to completing any repair request. This report contains technical information and if you do not understand or are unclear about some of the information contained in the body of this report; please call us to arrange for a verbal consultation prior to the expiration of any time limitations such as option or warranty periods. *Renner Inspection Services, PLLC assumes no liability for any items listed in the complete report and omitted from this summary.*

ROOF COVERING MATERIALS

- The composition roofing material has experienced considerable granular lose in various locations throughout the roof.

ROOF STRUCTURES AND ATTICS

- The attic insulation was observed to be in contact with the chimney flue pipe.

WALLS (INTERIOR AND EXTERIOR)

- Interior wall stress cracks were observed in the various locations throughout the house.
- Recommend sealant material improvements for the area between the interior walls and window frames.
- Caulking improvements are recommended for the area between the exterior veneer and the exterior door frames, window frames and garage door trim boards.
- Mortar improvements are recommended for the exterior masonry veneer on the south side of the structure.
- Exterior wall trim was observed to be pulling away in the north side of the structure.
- of the exterior wood trim surfaces needs a fresh coat of paint.

CEILINGS AND FLOORS

- Ceiling stress cracks were observed in the dining room area, garage, front corner bedroom, front entrance area.
- Ceiling opening was observed in the front corner bedroom closet.
- The floor tile(s) were observed to be cracked and/or damaged in dining room area.

DOORS (INTERIOR AND EXTERIOR)

- The door hardware is missing to the pantry.
- Weather-stripping improvements are recommended for the exterior doors.
- The exterior door frame has some deterioration and/or damage to the backyard entry door(s).
- The overhead garage door was observed to be unlevel.

WINDOWS

- One or more of the thermal pane windows were observed to have lost their seals. This has resulted in condensation or a fog like film to develop between the panes of glass. The thermal pane windows no longer function as designed when they loose their seal and replacement may be necessary. The windows that have noticeably lost their seals are listed but may not be limited to the following:
side middle bedroom, front corner bedroom.

BRANCH CIRCUITS, CONNECTED DEVICES, AND FIXTURES

Receptacle Outlets

- All exterior receptacles should have weather tight (bubble) covers.

Carbon Monoxide Alarms

- I was unable to locate a carbon monoxide alarm in the immediate vicinity of the bedrooms.

COOLING EQUIPMENT

- The outside condenser/coil does not appear to have proper clearance above the finish grade (ground).

PLUMBING SUPPLY, DISTRIBUTION SYSTEMS AND FIXTURES

Exterior Faucets/Fixtures

- One or more of the exterior water hose bibbs (faucet) do not have a back-flow or anti-siphon device (Vacuum Breakers) in place.
Note: *This is not uncommon to observe with a home of this age and can easily be obtained at home improvement stores if desired.*
- The exterior water hose bibb (faucet) is leaking at the handle when operated on the south side of the structure.

Hall Bathroom

Bathtub

- The shower spout is leaking at the neck connection.
- The bathtub shower head diverter is not functioning properly.

Shower

- The shower spout is leaking at the neck connection.

WATER HEATING EQUIPMENT

- The plastic tubing / piping being used for the temperature and pressure relief (TPR) valve discharge pipe is not listed nor labeled for this type of use.
- The temperature and pressure relief discharge pipe is terminating into the water heater drain pan. Under current building standards, this discharge pipe should run downward to the exterior of the structure, turn downward, and terminate within 6-inches of the ground.
- The water heater flue collar is loose.

DISHWASHERS

- The dishwasher soap dispenser component was observed to be damaged.

RANGES, COOKTOPS, AND OVENS

- The range can be easily tipped over and should be equipped with an anti-tip device, for safety.

MICROWAVE OVENS

- The microwave oven exterior handle was observed to be damaged.
- The microwave oven turn table does not appear to be functioning properly.

MECHANICAL EXHAUST VENTS AND BATHROOM HEATERS

- One or more of the light bulbs were observed to be inoperative in the hall bathroom.
- The bathroom heater is inoperative in the hall bathroom.

GARAGE DOOR OPERATORS

- The opener arm is loose at the door connection and needs to be re-secured.
- The garage door reverse sensors are not properly installed. The garage door reverse sensors should be installed within 6-inches of the garage floor.

DRYER EXHAUST SYSTEMS

- The dryer exhaust duct (vent pipe) is dirty and needs to be cleaned.
- The dryer duct termination is not properly sealed on the attic side of the roof structure penetration and is allowing dryer lint to fall back into the attic area.

LANDSCAPE IRRIGATION (SPRINKLER) SYSTEMS

- One or more of the sprinkler heads need to be adjusted so not to spray water onto the exterior walls, surfaces or windows in stations; **2**.
- One or more of the sprinkler heads do not pop-up high enough to disperse water properly in station(s); **1**.
- One or more of the sprinkler heads do not disperse water properly in stations(s); **1**.
- One or more of the sprinkler heads were observed to be damaged and/or missing in station(s); **1, 3**.
- The drip irrigation line below the grass appears to be damaged in station(s); **1**.